

**Work Order ID-56621**

Tuesday, March 02, 2010 11:16:16 AM



Page 1

Item ID: D3391-023

Accept



Setup Start



Revision ID:

Stop



Item Name: Mid Tube Assembly

Start Date: 3/3/2010 Start Qty: 1.00



Cust Item ID:

Required Date: 3/24/2010 Req'd Qty: 1.00



Customer:

Reference:

Approvals:

Process Plan: MEDate: 10-3-2

Tooling:

Date:

QC:

Date:

SPC (Y/N):

Date:

Run Start



Stop

Sequence ID/  
Work Center IDOperation  
DescriptionSet Up/  
Run HoursDraw  
NumberDraw  
Rev.Plan  
CodeAccept  
QtyReject  
QtyReject  
NumberInsp.  
Stamp

Draw Nbr

Revision Nbr

D3391

Rev H

100

0.00



Skidtubes

Skidtubes

Memo

0.00

Skidtubes

1-Cut tube to finish length as per Dwg D3391

2-Identify as D3391-023

3-Drill pilot holes using DT8796 (Do not drill "B" holes) and drill only 1 fwd saddle hole on one side only as per Dwg D3391

4-Open saddles and GHW holes to Ø0.375" except for fwd saddle hole of detail "J"

5-Remove .030" from Fwd indexing Ridge as per Dwg D3391

6-Remove indexing ridge on Fwd &amp; Aft end of skidtube as per Dwg D3391

7-Deburr

8-Drill #30 pilot holes using wearplate Jig DT8217 Identify Ø0.250" holes with paint marker,

9-Open wearplate holes of D3391-023 assembly detail section G-G to Ø0.250" (14 holes) as per Dwg D3391 and 2 holes in section Detail "J", do not open wearplate holes of section "J"

10-Open wearplate holes of D3391-023 assembly detail section H-H to Ø0.297" (20 holes) as per Dwg D3391

4/2/3/3

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

**Work Order ID 56621**

Tuesday, March 02, 2010 11:16:16 AM



Page 2

Item ID: D3391-023

Accept



Setup Start



Revision ID:

Stop



Item Name: Mid Tube Assembly

Start Date: 3/3/2010 Start Qty: 1.00



Cust Item ID:

Required Date: 3/24/2010 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start



QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop

Sequence ID/  
Work Center IDOperation  
DescriptionSet Up/  
Run HoursDraw  
NumberDraw  
Rev.Plan  
CodeAccept  
QtyReject  
QtyReject  
NumberInsp.  
Stamp

11-Open .375" holes to .438" \*\*\*do not open fwd saddle holes\*\*\*

12-Locate D3391-021 in D3391-023 at 9.00" (see view z-z)

13- Transfer drill one fwd saddle hole only to .188" dia, transfer drill all remaining fwd saddle holes using DT 8149 locating from previously drill .188" dia hole, using t-pins and clicos to ensure perfect allingment, open up previously tranfer drilled pilot holes in D3391-023/-021 to 0.438" dia. in D3391-021

14- Transfer drill 2 wearplate holes into D3391-021 using DT8217, locating from two previously drilled holes, drill remaining wearplate holes into D3391-021.

15- Locating from two fwd wearplate holes drilol remaining 6 wearplte holes in D3391-021 using DT8937

16- Open 2 fwd wearplate holes in D3391-023 to .250" dia.

17- counterbore two aft wearplate holes in D3391-021 as per dwg

18- Open 12 wearplate holes in D3391-021 to 0.297" dia.

19-Deburr and blow out all chips from inside tube

M10/3/13

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

**Work Order ID 56621**

Tuesday, March 02, 2010 11:16:16 AM



Page 3

Item ID: D3391-023

Accept



Setup Start



Revision ID:

Stop



Item Name: Mid Tube Assembly

Start Date: 3/3/2010 Start Qty: 1.00



Cust Item ID:

Required Date: 3/24/2010 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start



QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop

Sequence ID/  
Work Center IDOperation  
DescriptionSet Up/  
Run HoursDraw  
NumberDraw  
Rev.Plan  
CodeAccept  
QtyReject  
QtyReject  
NumberInsp.  
Stamp

110

QC5- Inspect part completeness to step on W/O

0.00

8/03/04



QC

Memo

0.00

Quality Control

120

Chemical Conversion Coat per QSI005 4.1

0.00



HandFinish

Memo

0.00

Hand Finishing

1

M 10/3/14

130

QC3- Inspect Part Finish

0.00



QC

Memo

0.00

Quality Control

BE 10/03/04

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

**Work Order ID 56621**

Tuesday, March 02, 2010 11:16:16 AM



Page 4

Item ID: D3391-023

Accept



Setup Start



Revision ID:

Stop



Item Name: Mid Tube Assembly

Start Date: 3/3/2010 Start Qty: 1.00



Cust Item ID:

Required Date: 3/24/2010 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start



QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Draw Number	Draw Rev.	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
140 	Skid tubes	0.00							
Skid tubes	<b>Memo</b> 1-Open float bag holes as per dwg 2-C'sink float bag holes as per dwg 3- Prepare tube for welding 4-Bond web in place as per Dwg D3391 & QSI 015. Adhere for 12 hours) A/R Sikaflex exp: <u>M112429</u> batch#: <u>1018150</u>	0.00							
Skid tubes									
150 	QC5- Inspect part completeness to step on W/O	0.00							
QC	<b>Memo</b>	0.00							
Quality Control									
160 	Skid tubes	0.00							
Skid tubes	<b>Memo</b> 1-Weld crossbolt spacer as per dwg D3391 & QSI 004 2-grind weld flush	0.00							
Skid tubes									

M 101314

BE 10/03/08

BE 10/03/08

A/R M113207

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries










**Work Order ID 56621**





Tuesday, March 02, 2010 11:16:16 AM



Page 5

Item ID: D3391-023 Accept  Setup Start   
Revision ID: Stop   
Item Name: Mid Tube Assembly  
Start Date: 3/3/2010 Start Qty: 1.00  Cust Item ID:  
Required Date: 3/24/2010 Req'd Qty: 1.00  Customer:  
Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_ Run Start   
QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_ Stop 

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Draw Number	Draw Rev.	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
170  QC Quality Control	QC10- Inspect visual per QSI004- ground welds  Memo	0.00 0.00	8/06/07						
180  QC Quality Control	QC5- Inspect part completeness to step on W/O  Memo	0.00 0.00	8/06/07						
190  Powdercoat Powder Coating	White Gloss(Ref:4.3.5.1) per QSI005 4.3-Alum M114/B41 Memo START TIME: 8:00 OVEN TEMPERATURE: 320° FINISH TIME: 8:30	0.00 0.00							

PTO = 7

① BR 10-8-31.

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector
10/08/30	180.1	Pressure Wash & Rebalance as per PAR-043	JD	10/08/30	✓		S 10/08/31

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

**Work Order ID 56621**

Tuesday, March 02, 2010 11:16:16 AM



Page 6

Item ID: D3391-023

Accept



Setup Start



Revision ID:

Stop



Item Name: Mid Tube Assembly

Start Date: 3/3/2010 Start Qty: 1.00



Cust Item ID:

Required Date: 3/24/2010 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start



QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop

Sequence ID/  
Work Center IDOperation  
DescriptionSet Up/  
Run HoursDraw  
NumberDraw  
Rev.Plan  
CodeAccept  
QtyReject  
QtyReject  
NumberInsp.  
Stamp

200

QC3- Inspect Part Finish

0.00

=) JM 10/08/31

x1

0



QC

Memo

0.00

Quality Control

210

Skidtubes

0.00

0.00

=) JM 10/08/31

1

0



Skidtubes

Memo

Skidtubes

✓ 1- insert D3391-021 into D3391-23

✓ 2- insert T-pins into first and third fwd saddle holes

✓ 3- ON FIRST SIDE ONLY drill out 2nd and forth fwd saddles holes to 0.500" as per DSI 9364

✓ 4- remove T-pins and locate DT9415 from first and third crossbolt hole using T-pins and clekos

✓ 5- ON 2ND SIDE ONLY ream out 2nd and forth saddle hole to 0.499". Remove DT9415

✓ 6- deburr, re-alodine and blow out chips

7- press fit D3591-1 spacers using DT9416 starting from 0.500" side

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

**Work Order ID 56621**

Tuesday, March 02, 2010 11:16:16 AM



Page 7

Item ID: D3391-023

Accept



Setup Start



Revision ID:

Stop



Item Name: Mid Tube Assembly

Start Date: 3/3/2010 Start Qty: 1.00



Cust Item ID:

Required Date: 3/24/2010 Req'd Qty: 1.00



Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start



QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop

Sequence ID/  
Work Center IDOperation  
DescriptionSet Up/  
Run HoursDraw  
NumberDraw  
Rev.Plan  
CodeAccept  
QtyReject  
QtyReject  
NumberInsp.  
Stamp

220



QC

Quality Control

QC5- Inspect part completeness to step on W/O

0.00

Memo

0.00

8/10/08/31

70

230



HandFinish

Hand Finishing

HandFinishing

Memo

Install Inserts as per Dwg

0.00

0.00

7/10/08/31

1 0

240



QC

Quality Control

QC5- Inspect part completeness to step on W/O

0.00

Memo

0.00

8/10/08/31

70

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

**Work Order ID 56621**

Tuesday, March 02, 2010 11:16:16 AM

Page 8

Item ID: D3391-023

Accept

Setup Start

Revision ID:

Stop

Item Name: Mid Tube Assembly

Start Date: 3/3/2010 Start Qty: 1.00

Cust Item ID:

Required Date: 3/24/2010 Req'd Qty: 1.00

Customer:

Reference:

Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Run Start

QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Stop

Sequence ID/  
Work Center IDOperation  
DescriptionSet Up/  
Run HoursDraw  
NumberDraw  
Rev.Plan  
CodeAccept  
QtyReject  
QtyReject  
NumberInsp.  
Stamp

250

Identify as per dwg & Stock Location: W/O 6/4/75 0.00

Packaging

Memo

0.00

ml 10 09 01 (1)

Packaging

260

QC21- Final Inspection - Work Order Release

0.00



QC

Memo

0.00

Quality Control

10/09/01 MF  
10-9-01

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



# Picklist Print

Tuesday, March 02, 2010 11:16:15 AM

Page 1

Work Order ID: 56621



Parent Item: D3391-023



Parent Item Name: Mid Tube Assembly

Start Date: 3/3/2010

Required Date: 3/24/2010

Comments: IPP A 05.10.20 New Issue KJ/EC  
 IPP B 06.02.10 ECN773 dwg rev.D EC  
 IPP C 07.03.20 rev F dwg EC  
 IPP D 07.03.28 re-format EC

Start Qty: 1.00

Required Qty: 1.00

D2500-1-100



Skidtube Extrusion

Manufactured No

100

Each

134.0000

1.0000



## Warehouse

## Loc Qty

## Loc Code

### Location

Main Warehouse

If

87

50251

87

Main Warehouse

ST

47

37065

47

D3391-021



Fwd Tube Assembly

Manufactured No

100

Each

0.0000

1.0000



B56494

B56494

1101313

1 1101313

D3389-1



Web

Manufactured No

140

Each

2.0000

1.0000



## Warehouse

## Loc Qty

## Loc Code

### Location

Main Warehouse

ST

2

48244

1

56510

1

B56624

2 1101314

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

# Picklist Print

Tuesday, March 02, 2010 11:16:15 AM

Page 2

Work Order ID: 56621



Parent Item: D3391-023



Parent Item Name: Mid Tube Assembly

Start Date: 3/3/2010

Required Date: 3/24/2010

Comments: IPP A 05.10.20 New Issue  
IPP B 06.02.10 ECN773 dwg rev:D  
IPP C 07.03.20 rev F dwg  
IPP D 07.03.28 re-format

KJ/EC  
EC  
EC  
EC

Start Qty: 1.00

Required Qty: 1.00

D3681-1



Spacer

Manufactured No 160 Each 39.0000 5.0000



Warehouse Loc Qty Loc Code

Location

Main Warehouse

LG 37

51920 20

52898 17

Main Warehouse

ST 2

47123 2

Manufactured No 210 Each 37.0000 2.0000

D3591-1



Bushing



Warehouse Loc Qty Loc Code

Location

Main Warehouse

ST 37

46105 29

47121 8

1357330 x2 1408/3

Tuesday, March 02, 2010 11:16:15 AM

Shop Packet Print

Page 2

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

# Picklist Print

Tuesday, March 02, 2010 11:16:15 AM

Work Order ID: 56621



Parent Item: D3391-023



Parent Item Name: Mid Tube Assembly

Start Date: 3/3/2010

Required Date: 3/24/2010

Comments: IPP A 05.10.20 New Issue  
 IPP B 06.02.10 ECN773 dwg rev.D  
 IPP C 07.03.20 rev F dwg  
 IPP D 07.03.28 re-format

KJ/EC  
 EC  
 EC  
 EC

Start Qty: 1.00

Required Qty: 1.00

ALS4-1032-130

Purchased

No

230

Each

1,498.000 22.0000



Insert

## Warehouse

## Loc Qty

## Loc Code

### Location

Main Warehouse

ST

110511

1498

1498

11114723

x22 22 10108131


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

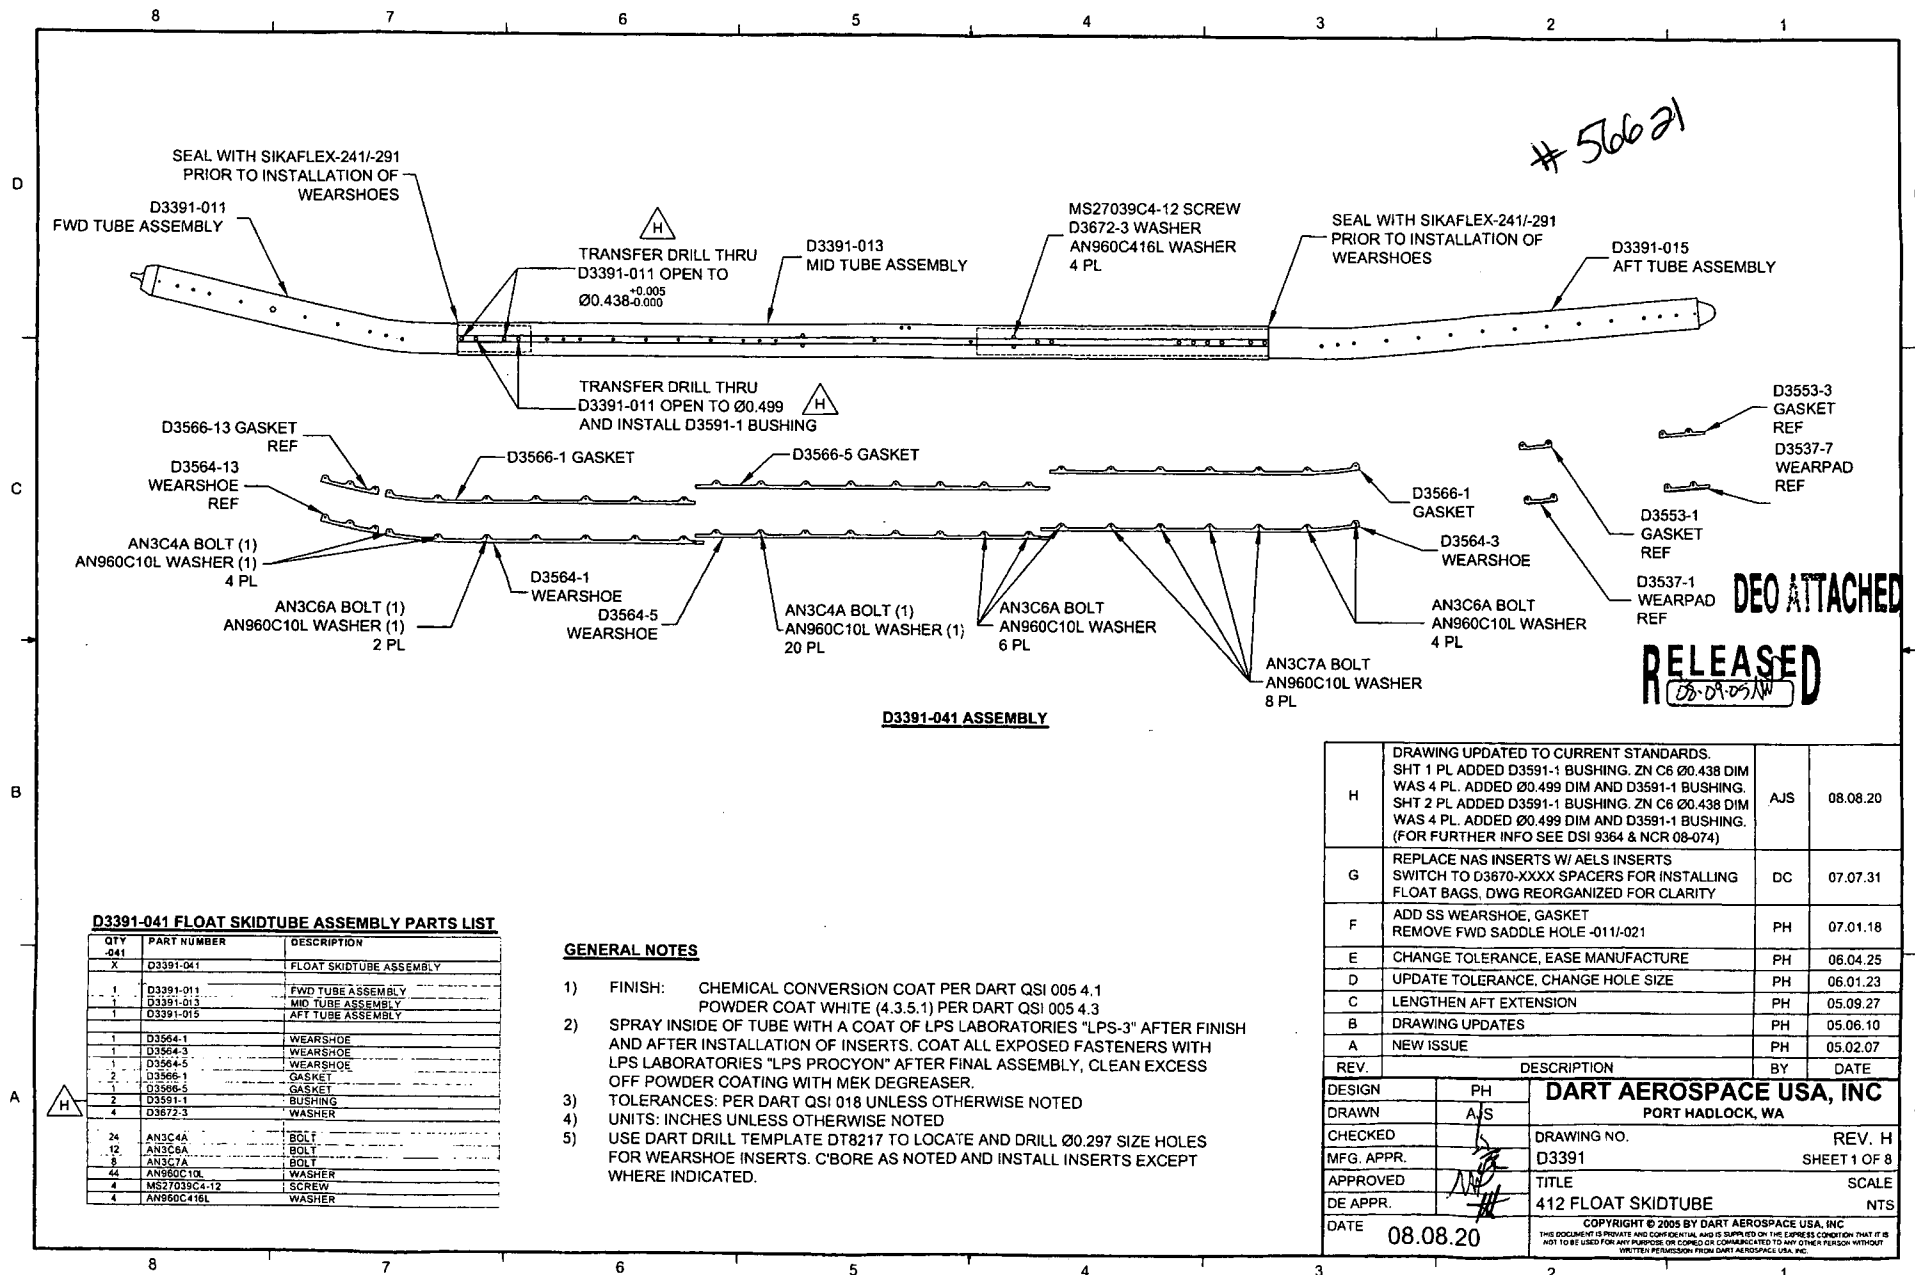

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_


Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



#50621

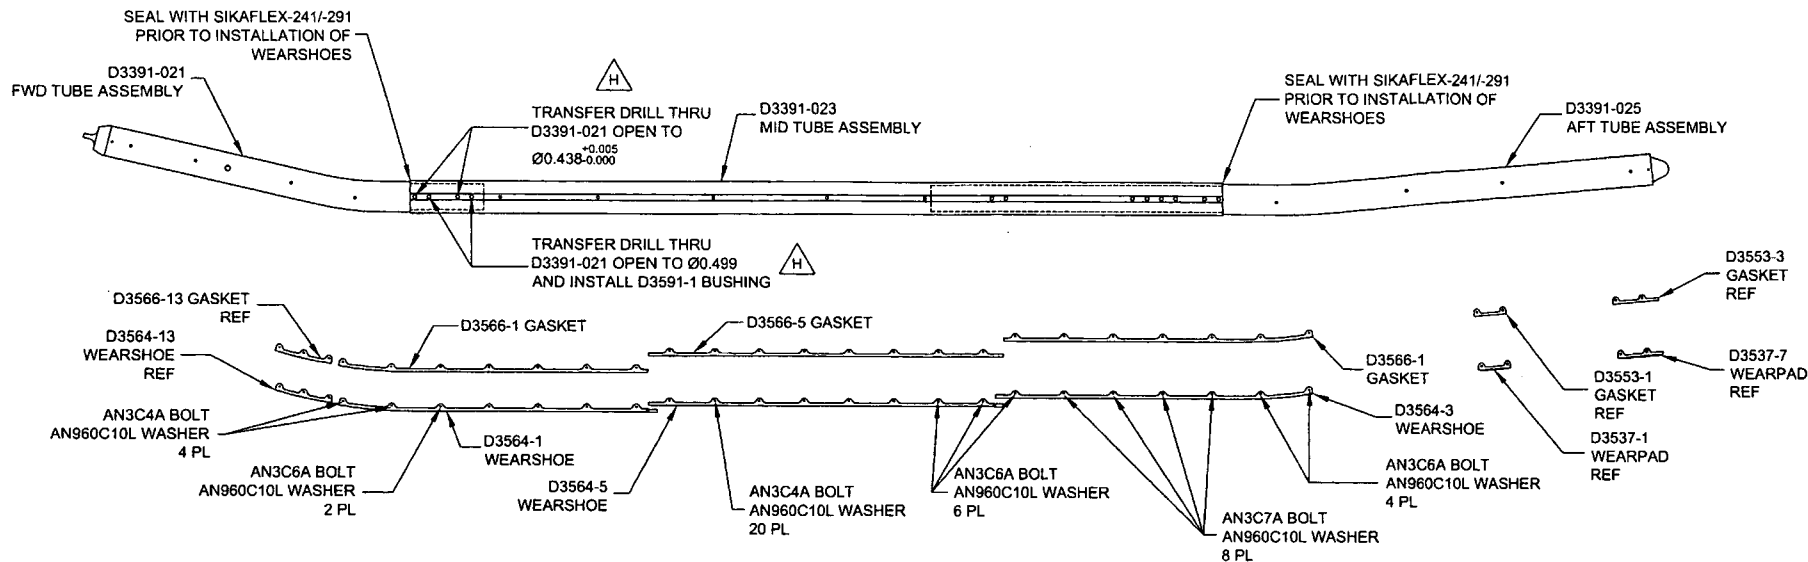

**D3391-043 ASSEMBLY**

**D3391-043 FLOAT SKIDTUBE ASSEMBLY PARTS LIST**





QTY	PART NUMBER	DESCRIPTION
X	D3391-043	FLOAT SKIDTUBE ASSEMBLY
1	D3391-021	FWD TUBE ASSEMBLY
1	D3391-023	MID TUBE ASSEMBLY
1	D3391-025	AFT TUBE ASSEMBLY
1	D3564-1	WEARSHOE
1	D3564-3	WEARSHOE
1	D3564-5	WEARSHOE
2	D3566-1	GASKET
1	D3566-5	GASKET
2	D3591-1	BUSHING
24	AN3C4A	BOLT
12	AN3C6A	BOLT
8	AN3C7A	BOLT
44	AN960C10L	WASHER

**GENERAL NOTES**

- 1) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2) SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY. CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 SIZE HOLES FOR WEARSHOE INSERTS. C'BORE AS NOTED AND INSTALL INSERTS EXCEPT WHERE INDICATED.

DEO ATTACHED

RELEASED  
08-09-25-17

DESIGN	PH	<b>DART AEROSPACE USA, INC</b>	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D3391	SHEET 2 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_


Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			


**NOTE:** Date & initial all entries

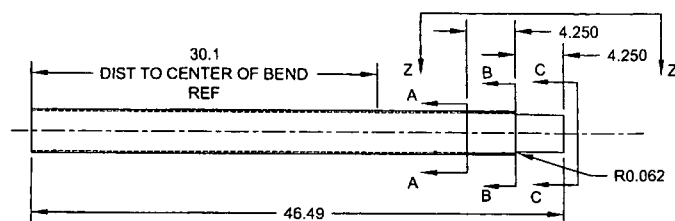


**D3391-1 CUTTING DETAIL**  
(MAKE FROM D6013-047 SKIDTUBE MATERIAL)

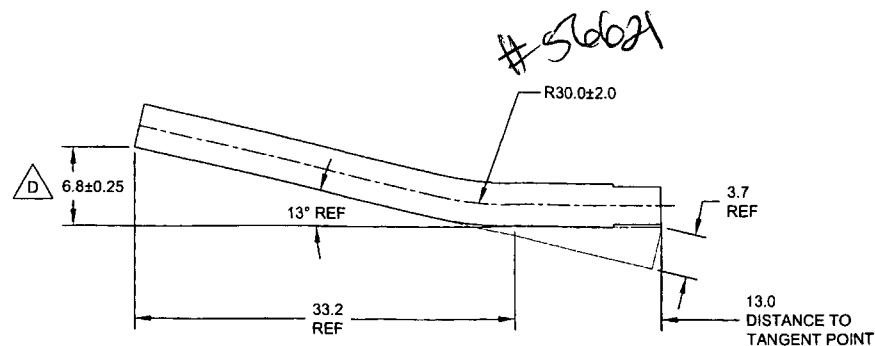


**D3391-011/-021 BENDING DETAIL**  
(MAKE FROM D3391-1)

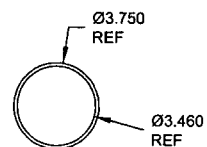


**SECTION A-A**  
SCALE 2X

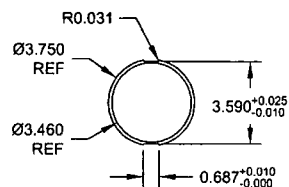

**SECTION B-B**  
SCALE 2X

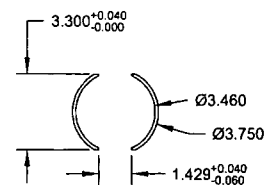

**SECTION C-C**  
SCALE 2X

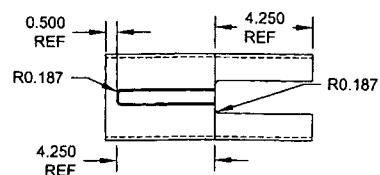

**VIEW Z-Z**  
SCALE 2X

DEO ATTACHED  
RELEASED  
28-05-11

DESIGN	PH	<b>DART AEROSPACE USA, INC</b>	
DRAWN	AUS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D3391	SHEET 3 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	<small>COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

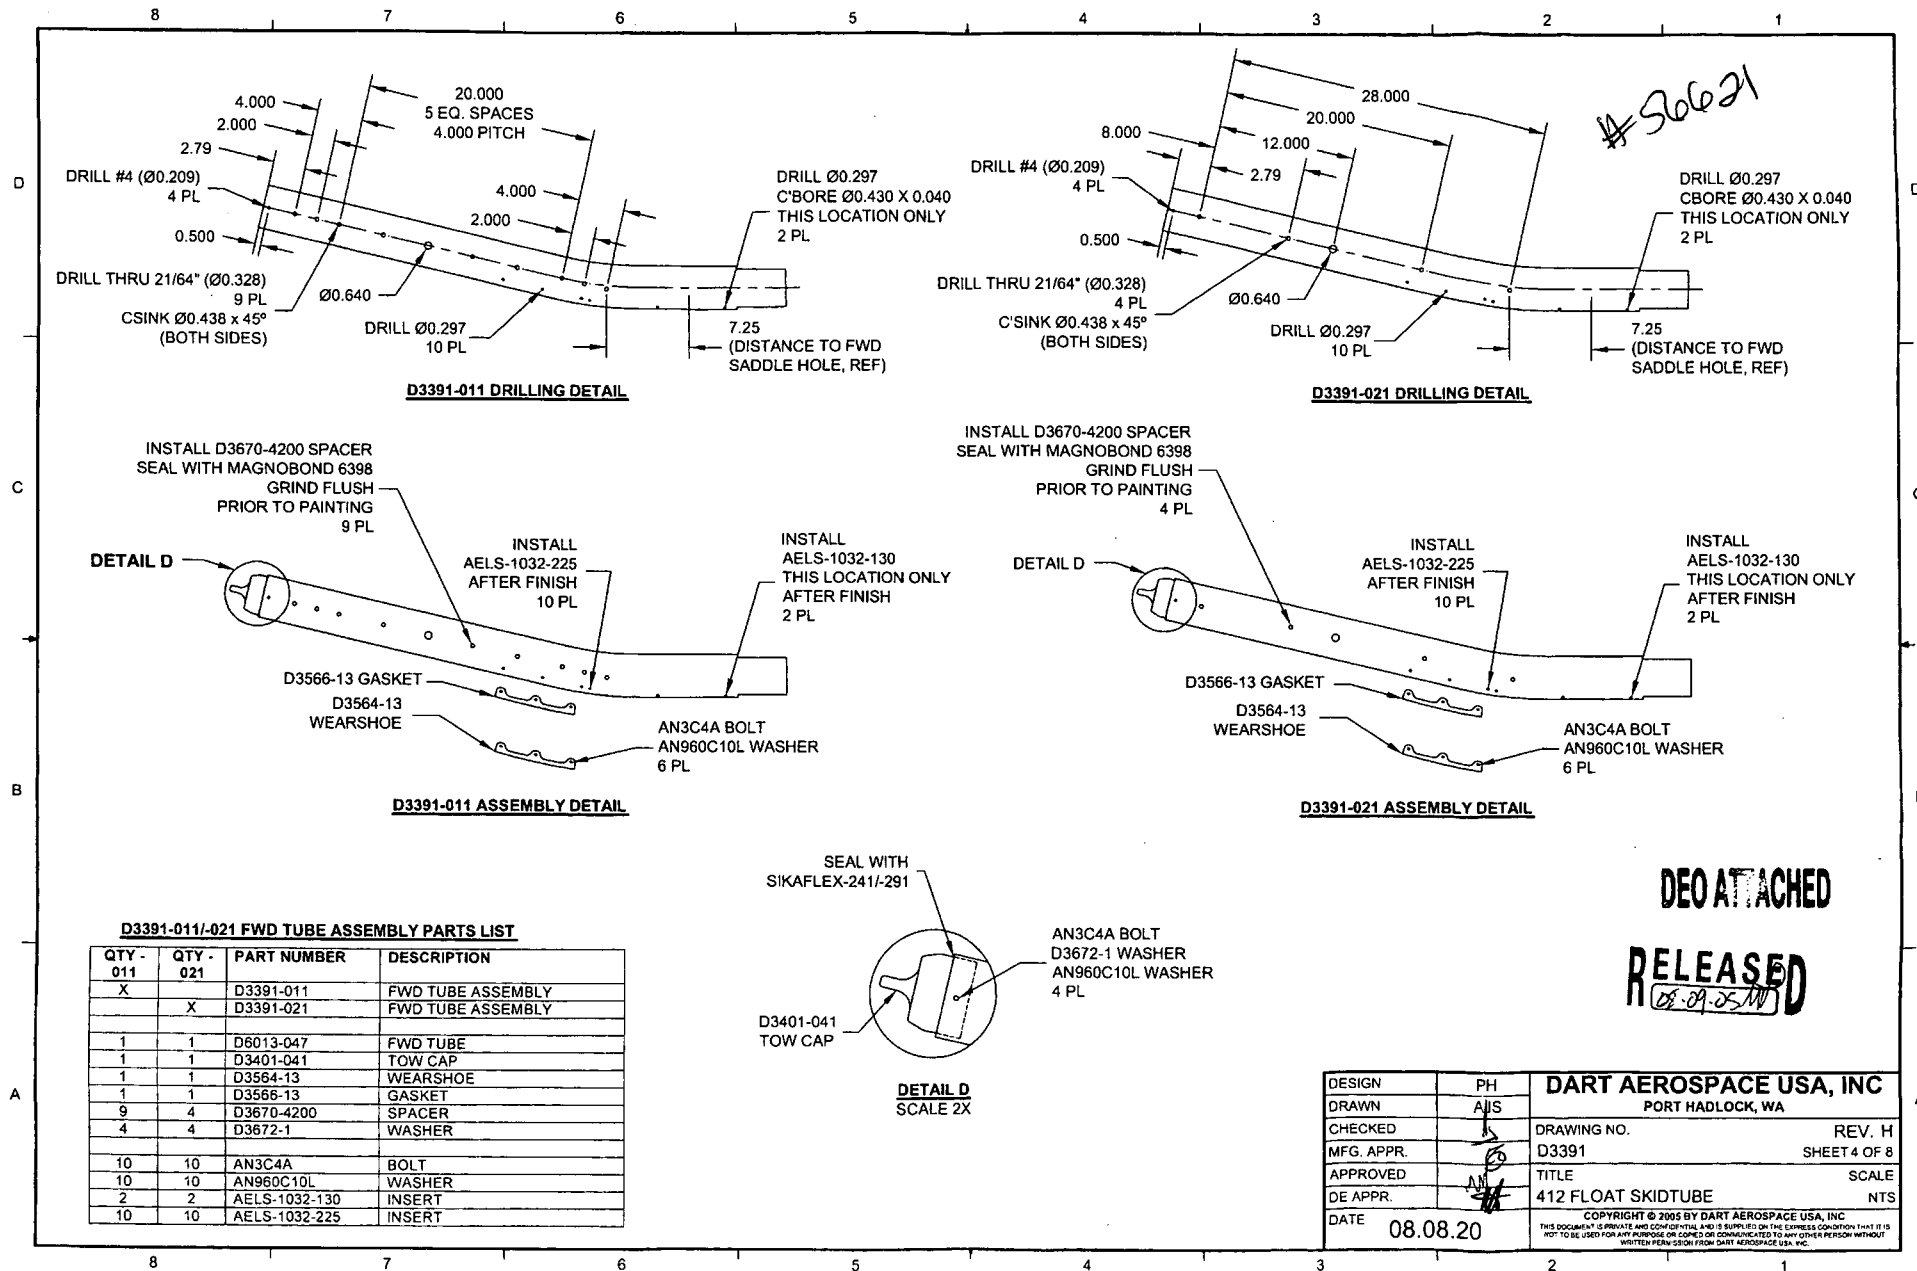








W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

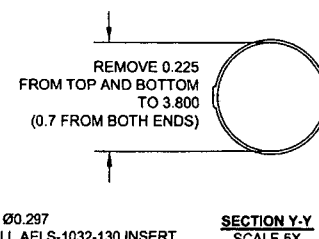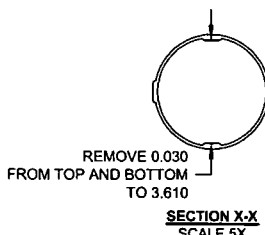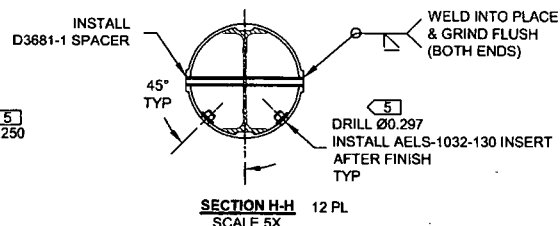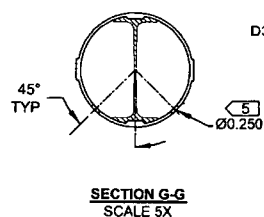
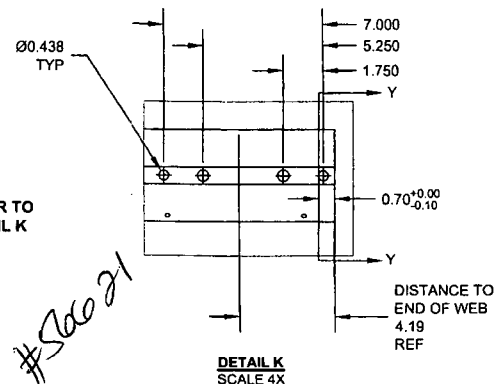
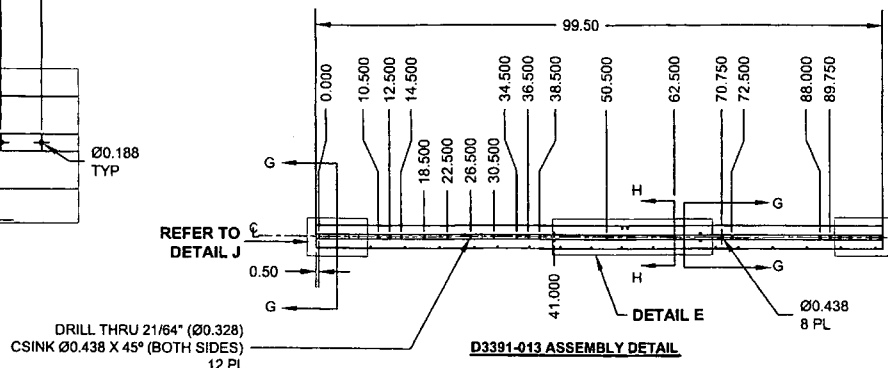
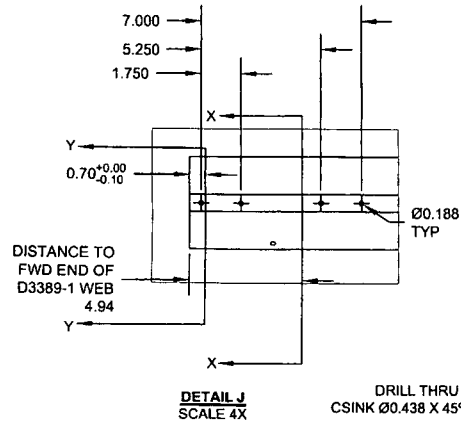


# **D3391-013 MID TUBE ASSEMBLY PARTS LIST**

QTY	PART NUMBER	DESCRIPTION
-013		
X	D3391-013	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
4	D3672-1	WASHER
4	D3672-3	WASHER
12	D3681-1	SPACER
24	AELS-1032-130	INSERT
4	ALS4-428-165	INSERT
4	AN960C10L	WASHER
4	AN960C416L	WASHER
4	MS27039C1-09	SCREW
4	MS27039C4-08	SCREW

## **D3391-013 MID TUBE ASSEMBLY**

- 1) MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
- 2) INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/291 PER QSI 015
- 3) WELDING: PER DART QSI 004

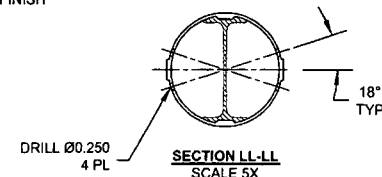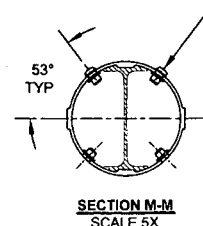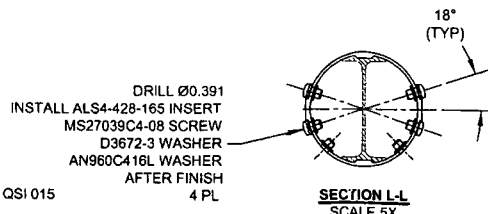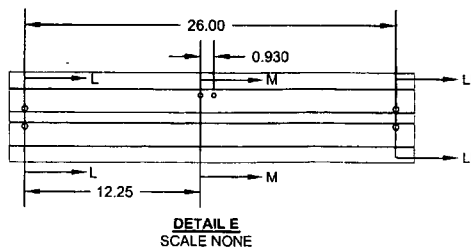

**DEO ATTACHED** **RELEASED**

DESIGN	PH	<b>DART AEROSPACE USA, INC</b>
DRAWN	AJS	PORT HADLOCK, WA
CHECKED		DRAWING NO. REV. H
MFG. APPR.		D3391 SHEET 5 OF 8
APPROVED		TITLE SCALE
DE APPR.		412 FLOAT SKIDTUBE NTS
DATE	08.08.20	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries






W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

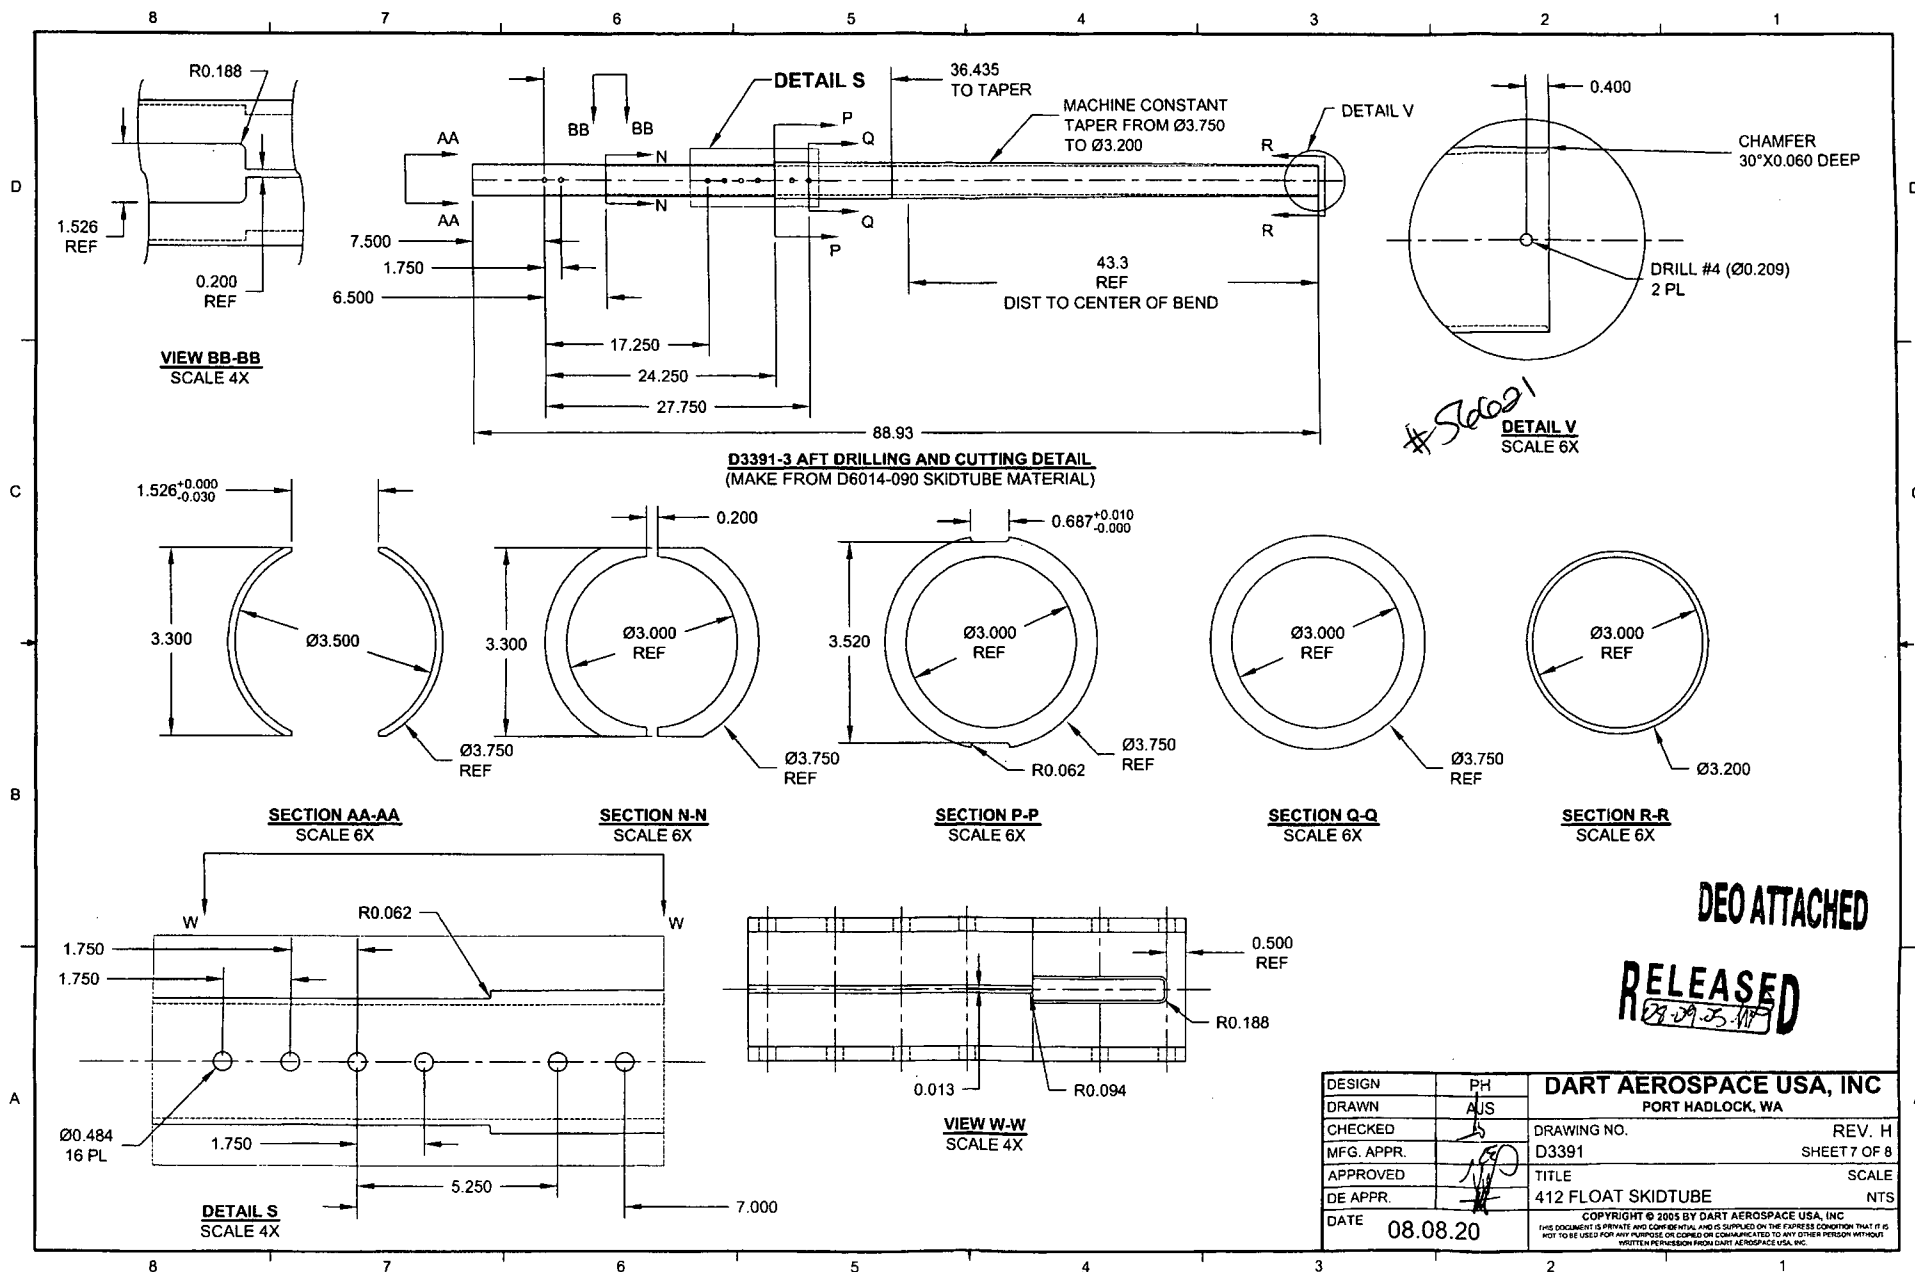

DESIGN	PH	<b>DART AEROSPACE USA, INC</b>	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D3391	SHEET 7 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	<small>COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_


NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

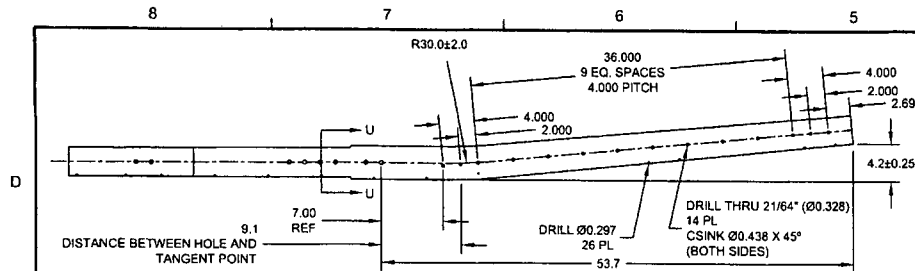

**D3391-015 BENDING AND DRILLING DETAIL**  
(SEE CBORE DETAIL BELOW)

INSTALL D3670-4200 SPACER  
SEAL WITH MAGNOBOND 6398  
GRIND FLUSH  
PRIOR TO PAINTING  
14 PL

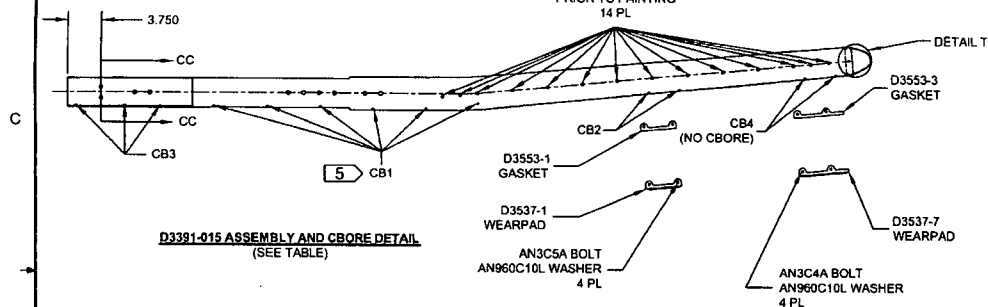




**D3391-015 ASSEMBLY AND CBORE DETAIL**  
(SEE TABLE)

**D3391-015/-025 AFT TUBE ASSEMBLY PARTS LIST**

QTY - 015	QTY - 025	PART NUMBER	DESCRIPTION
X		D3391-015	AFT TUBE ASSEMBLY
	X	D3391-025	AFT TUBE ASSEMBLY
1	1	D6014-090	AFT TUBE
1	1	D2646	AFT CAP
1	1	D3537-1	WEARPAD
1	1	D3537-7	WEARPAD
1	1	D3553-1	GASKET
1	1	D3553-3	GASKET
14	4	D3670-4200	SPACER
2	2	D3672-1	WASHER
14	14	AELS-1032-130	INSERT
12	12	AELS-1032-225	INSERT
4		ALS4-428-165	INSERT
6	6	AN3C4A	BOLT
4	4	AN3C5A	BOLT
10	10	AN960C10L	WASHER


CBORE HOLES MARKED CB1-CB4 AS FOLLOWS AND  
INSTALL AELS-1032-XXX AFTER FINISH AS NOTED

HOLES MARKED	QTY D3391-015	QTY D3391-025	CBORE	P/N
CB1	12	12	Ø0.430 X 0.170	AELS-1032-225
CB2	4	4	Ø0.430 X 0.170	AELS-1032-130
CB3	6	6	Ø0.430 X 0.040	AELS-1032-130
CB4	4	4	NONE	AELS-1032-130

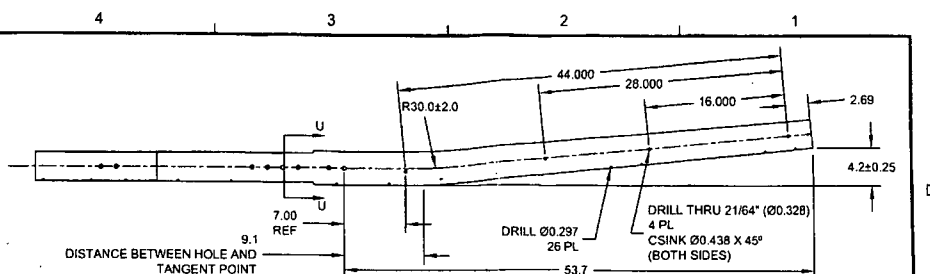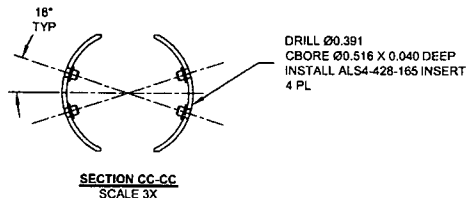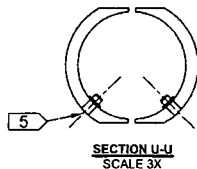


**D3391-025 BENDING AND DRILLING DETAIL**  
(SEE CBORE DETAIL BELOW)

INSTALL D3670-4200 SPACER  
SEAL WITH MAGNOBOND 6398  
GRIND FLUSH  
PRIOR TO PAINTING  
4 PL

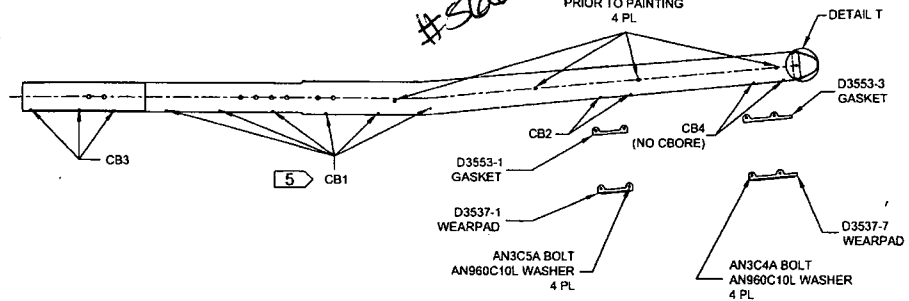

**D3391-025 ASSEMBLY AND CBORE DETAIL**  
(SEE TABLE)

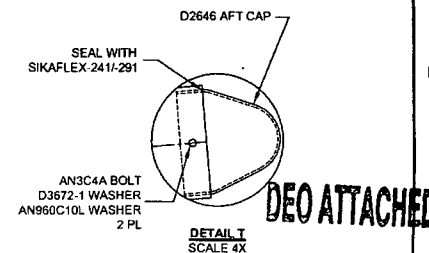

DEO ATTACHED

RELEASED  
08-09-2010

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D3391	SHEET 8 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	08.08.20	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

DRAWING NO. D3391	TITLE 412 FLOAT SKIDTUBE	REV. H	DART AEROSPACE USA, INC ENGINEERING ORDER		D.E.O. NO. D3391-H-1	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN <i>CP</i>	CHECKED <i>h</i>	MFG. APPR. <i>AA</i>	APPROVED <i>MP</i>		DE APPR. <i>#</i>		
DATE 09.09.23	DATE <i>06.04.24</i>	DATE <i>09/09/25</i>	DATE <i>09/29/30</i>		DATE <i>09/09/30</i>		

**PURPOSE:**

LPS-3 IS NO LONGER USED DURING ASSEMBLY OF D3391-041/-043 SKIDTUBES.

**CHANGE:**

AMEND NOTE 2 OF D3391-041/-043 SKIDTUBE ASSEMBLIES (ZN A6-1, A6-2) AS FOLLOWS:

- 2) ~~SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH~~  
~~AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH~~  
LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS  
OFF POWDER COATING WITH MEK DEGREASER.

**RELEASED**  
2010-02-02

*MP*

*#36021*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



NO. 224

AWS D17.1.2001  
QUALIFICATION TEST RECORD

Name: Burden Elliott  
Job number: 53938  
Part number: D3391-023  
Description: Hot Mid tube  
Welding Process: Tig[☒] Mig[ ]  
Base material: Aluminum  
Current: AC[ ] DC[ ]

TEST REQUIREMENTS AND RESULTS

Visual: pass[☒] fail[ ]  
Penetration: pass[☒] fail[ ]

UNACCEPTABLE

Cracks: pass[☒] fail[ ]  
Undercut: pass[☒] fail[ ]  
Pin holes: pass[☒] fail[ ]  
Overlap (cold lap): pass[☒] fail[ ]  
Porosity (surface): pass[☒] fail[ ]  
Coloration: pass[☒] fail[ ]

Qualifier [Signature] Date of Test Coupon 10-02-18

Welder [Signature] Date of Test Coupon 10-02-18

The above named individual is qualified in accordance with AWS D17.1.2001 to weld